

A60/C60/C61

Level 2.5

Repair Documentation

V 1.0

V 1.0	Page 1 of 13	ICM MP CCQ GRM
A60/C60/C61	Company Confidential Copyright 2003© Siemens AG	09/03

Table of Content

1	Introduction.....	2
2	I/O Connector (Slim Lumberg).....	3
3	Battery Connector	6
4	Display Connector	8
5	Card Reader.....	10
6	Keypad LEDS.....	12

1 Introduction

A60 and C60 products are tripleband (GSM900, GSM1800 and GSM1900) handsets and the C61 is a dualband mobilphone (GSM850 and GSM1900)

Partnumber on IMEI label:

A60	S30880-S5870-#xxx
C60	S30880-S5850-#xxx
C61	S30880-S5880-#xxx

, while # may be any letter (A-Z) and xxx may be any number from 100, 101, 102....

This manual is intended to help you carry out repairs on level 2.5, meaning limited component repairs. The documented failure highlights should be repaired in the local workshops.

All repairs have to be carried out in an environment set up according to the ESD (Electrostatic Discharge Sensitive Devices) regulations defined in international standards.

If you have any questions regarding the repair procedures or technical questions about the spare parts do not hesitate to contact our technical support team in Kamp-Lintfort, Germany:

Tel.: +49 2842 95 4666
 Fax: +49 2842 95 4302
 e-mail: st-support@klf.siemens.de

V 1.0	Page 2 of 13	ICM MP CCQ GRM
A60/C60/C61	Company Confidential Copyright 2003© Siemens AG	09/03

2 I/O Connector (Slim Lumberg)

2.1 Affected Units

2.1.1 Type: C60/C61

2.1.2 Affected IMEIs / Date Codes: All / All

2.1.3 Affected SW Versions: All

2.2 Fault Description

2.2.1 Fault Symptoms for customers:

- Charging problems.
- Problems with external loudspeaker or microphone when using a car kit.
- Problems with accessories connected at the I/O - connector.
- Problems with SW booting

2.2.2 Fault Symptoms on GSM Tester:

This fault cannot be detected with a GSM-Tester

2.3 Repair Documentation:

2.3.1 Description of procedure:

2.3.1.1 Diagnosis:

Visually check the bottom connector. Watch for dry joints:

2.3.1.2 Repair by component change:

Use hot air blower remove defective I/O connector.
Avoid excessive heat!
Watch surrounding components!

Resolder new I/O connector afterwards.

2.3.1.3 Repair by Software booting:

Not possible!

2.3.1.4 Test:

Retest handset after repair.

V 1.0	Page 3 of 13	ICM MP CCQ GRM
A60/C60/C61	Company Confidential Copyright 2003© Siemens AG	09/03

2.3.2 List of needed material:

2.3.2.1 Components:

I/O Connector C60/C61
Part-Number: L36334-Z93-C303

2.3.2.2 Jigs and Tools:

Hot Air Blower
Soldering Iron

2.3.2.3 Special tools:


None

2.3.2.4 Working materials

Desolder Wick / Braid
Solder

2.3.3 Drawings

Figure 1: C60/C61 board I/O connector

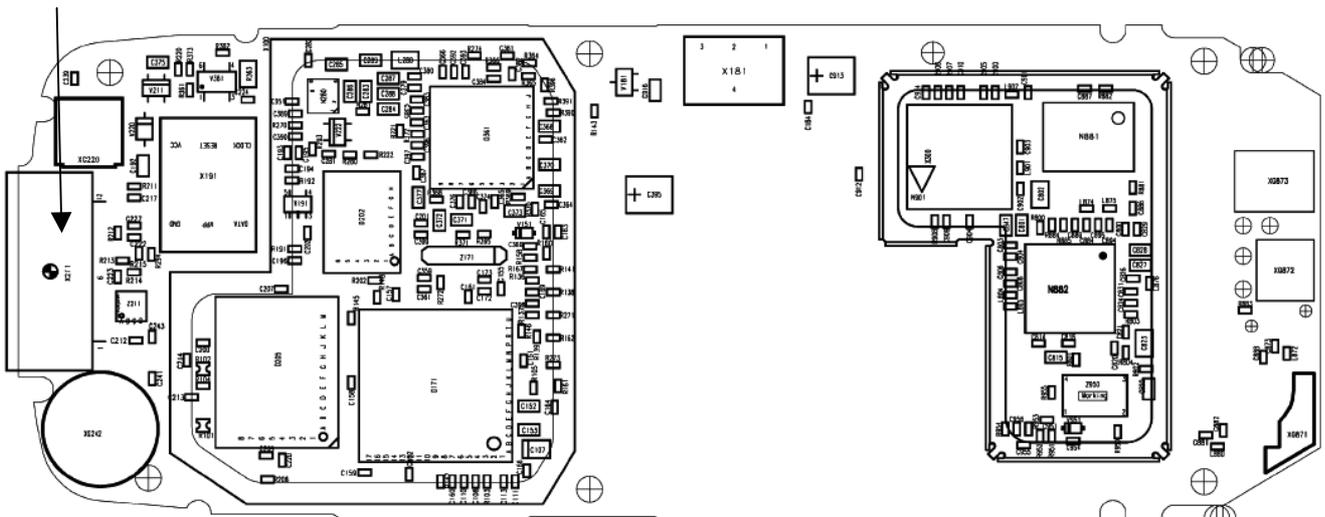

V 1.0	Page 4 of 13	ICM MP CCQ GRM
A60/C60/C61	Company Confidential Copyright 2003© Siemens AG	09/03

Figure 2: C60/C61 I/O connector placement (top view)

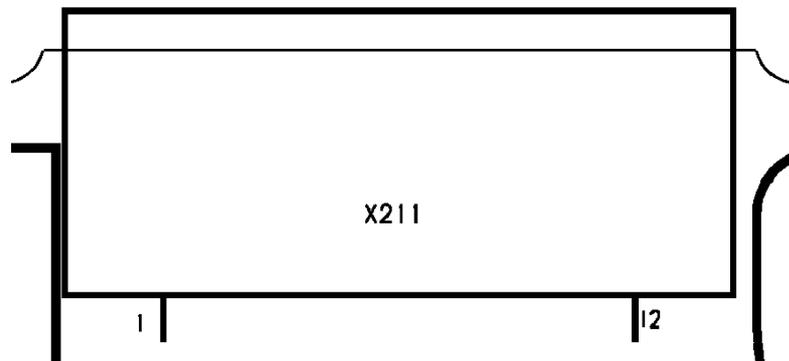


Table 1: C60/C61 Bottom Connector Pin Description

Pin	Name	IN/OUT	Notes
1	POWER	I/O	POWER is needed for charging batteries and for supplying the accessories
2	GND		
3	TX_1	O	Serial interface
4	RX_1	I	Serial interface
5	CTS_1	I/O	Data line for accessory bus
6	RTS_1	I/O	Use as RTS in data operation
7	DCD_1	I/O	Clock line for accessory bus Use as DTC In data operation
8	AUDIO_P	O	External loudspeaker
9			
10	AUDIO_N	OI	External loudspeaker
11	GND_MIC	I	External microphone
12	MICP2	O	External microphone

3 Battery Connector

3.1 Affected Units

3.1.1 Type: C60/C61

3.1.2 Affected IMEIs / Date Codes: All / All

3.1.3 Affected SW Versions: All

3.2 Fault Description

3.2.1 Fault Symptoms for customers:

Mobile does not switch on.
Error message "WRONG BATTERY" on display.

3.2.2 Fault Symptoms on GSM Tester:

This fault cannot be detected with a GSM-Tester.

3.3 Repair Documentation:

3.3.1 Description of procedure:

3.3.1.1 Diagnosis:

Visually check the status of the Battery connector. Watch for oxidation and dry solder joints.

3.3.1.2 Repair by component change:

Use hot air blower remove defective Battery connector.
Avoid excessive heat!
Watch surrounding components!

Resolder new Battery connector afterwards.

3.3.1.3 Repair by Software booting:

Not possible!

3.3.1.4 Test:

Retest handset after repair.

3.3.2 List of needed material:

3.3.2.1 Components:

Battery Connector C60/C61
Part-Number: L36334-Z97-C213

V 1.0	Page 6 of 13	ICM MP CCQ GRM
A60/C60/C61	Company Confidential Copyright 2003© Siemens AG	09/03

3.3.2.2 Jigs and Tools:

Hot Air Blower
Soldering Iron

3.3.2.3 Special tools:

None

3.3.2.4 Working materials

Desolder Wick / Braid
Soldering Iron

3.3.3 Drawings

Figure 1: C60/C61 board Battery connector


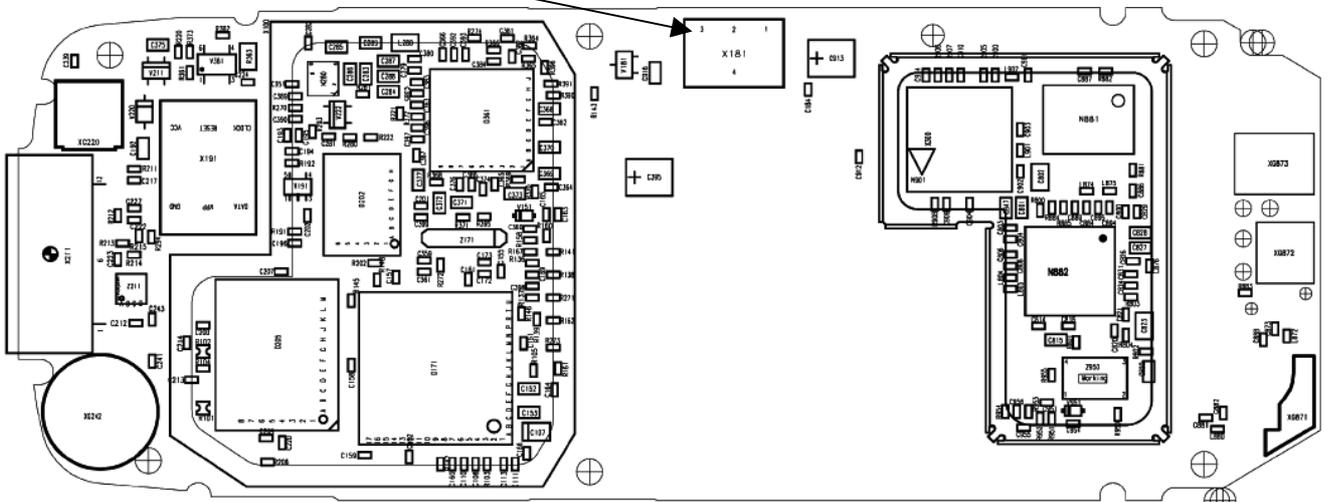


Figure 2: C60/C61 Battery connector placement (top view)

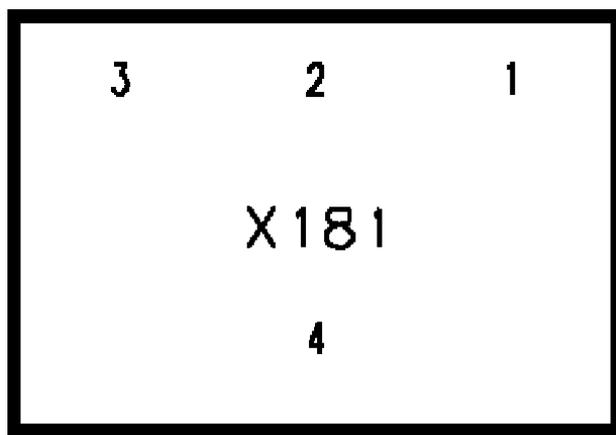

4 Display Connector

4.1 Affected Units

4.1.1 Type: C60/C61

4.1.2 Affected IMEIs / Date Codes: All / All

4.1.3 Affected SW Versions: All

4.2 Fault Description

4.2.1 Fault Symptoms for customers:

Display problems, like missing lines or columns on the LCD or display contrast problems.

4.2.2 Fault Symptoms on GSM Tester:

Display tests failed.

4.3 Repair Documentation:

4.3.1 Description of procedure:

4.3.1.1 Diagnosis:

Visually check the status of the Display connector. Watch for oxidation

4.3.1.2 Repair by component change:

Use hot air blower remove defective Display connector.

Avoid excessive heat!

Watch surrounding components!

Resolder new Display connector afterwards.

4.3.1.3 Repair by Software booting:

Not possible!

4.3.1.4 Test:

Retest handset after repair.

4.3.2 List of needed material:

4.3.2.1 Components:

Display Connector C60/C61

Part-Number: L36334-Z97-C205

V 1.0	Page 8 of 13	ICM MP CCQ GRM
A60/C60/C61	Company Confidential Copyright 2003© Siemens AG	09/03

4.3.2.2 Jigs and Tools:

Hot Air Blower
Soldering Iron

4.3.2.3 Special tools:

None

4.3.2.4 Working materials

Desolder Wick / Braid
Soldering Iron

4.3.3 Drawings

Figure 1: C60/C61 board Display connector


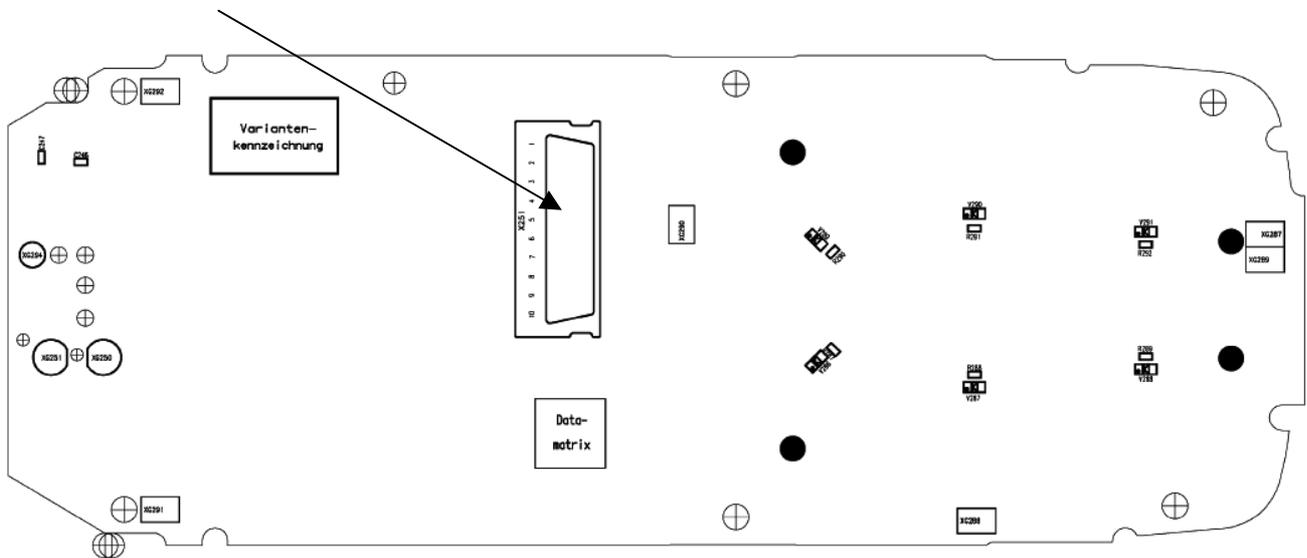


Figure 2: C60/C61 Display connector placement (top view)

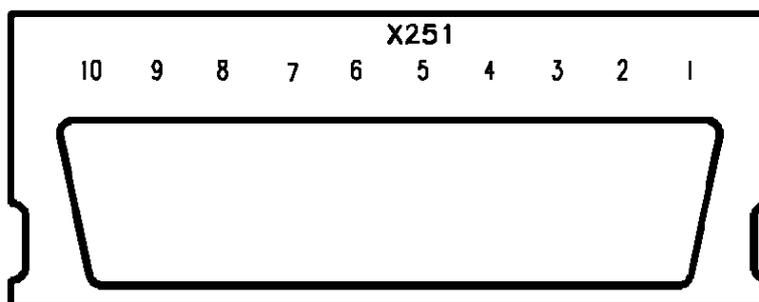

5 Card Reader

5.1 Affected Units

5.1.1 Type: C60/C61

5.1.2 Affected IMEIs / Date Codes: All / All

5.1.3 Affected SW Versions: All

5.2 Fault Description

5.2.1 Fault Symptoms for customers:

Handset does not accept SIM.

5.2.2 Fault Symptoms on GSM Tester:

This fault cannot be detected with a GSM-Tester

5.3 Repair Documentation:

5.3.1 Description of procedure:

5.3.1.1 Diagnosis:

Visually check the Card Reader. Watch for dry joints:

5.3.1.2 Repair by component change:

Use soldering iron to remove defective component.
Avoid excessive heat!
Watch surrounding components!

Resolder new Card Reader afterwards.

5.3.1.3 Repair by Software booting:

Not possible!

5.3.1.4 Test:

Retest handset after repair.

5.3.2 List of needed material:

5.3.2.1 Components:

Card Reader C60/C61
Part-Number: L36334-Z93-C204

V 1.0	Page 10 of 13	ICM MP CCQ GRM
A60/C60/C61	Company Confidential Copyright 2003© Siemens AG	09/03

5.3.2.2 Jigs and Tools:

Hot Air Blower
Soldering Iron

5.3.2.3 Special tools:

None

5.3.2.4 Working materials

Desolder Wick / Braid
Soldering Iron

5.3.3 Drawings

Figure 1: C60/C61 board Card Reader site


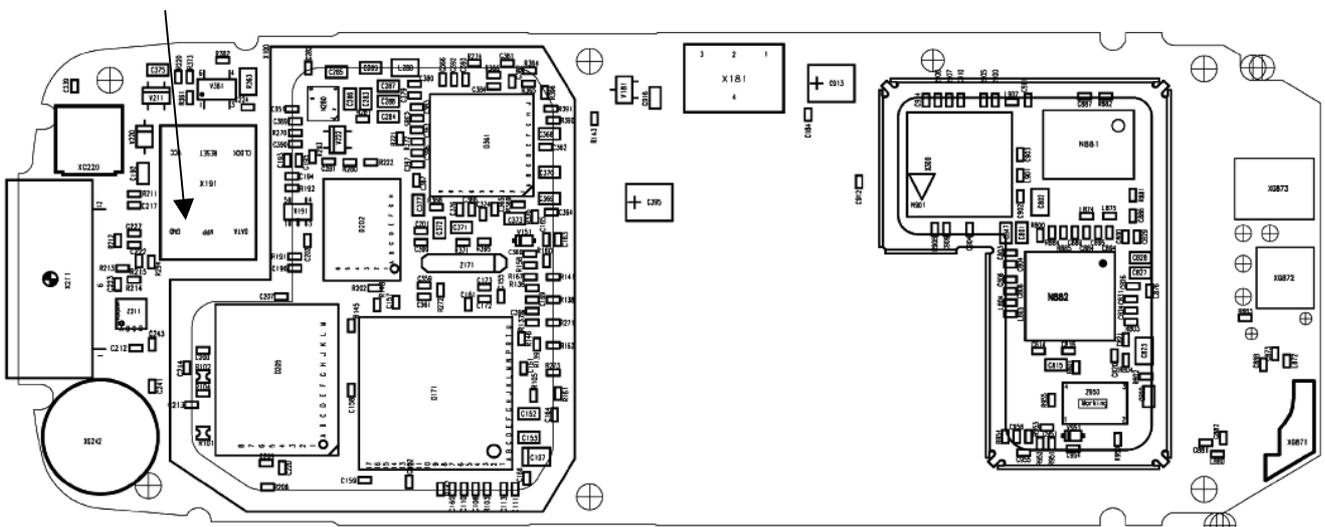


Figure 2: C60/C61 Card Reader placement (top view)

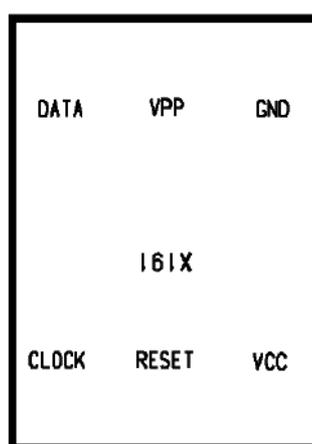

6 Keypad LEDS

6.1 Affected Units

6.1.1 Type: C60/C61

6.1.2 Affected IMEIs / Date Codes: All / All

6.1.3 Affected SW Versions: All

6.2 Fault Description

6.2.1 Fault Symptoms for customers:

Keypad illumination does not work.

6.2.2 Fault Symptoms on GSM Tester:

This fault cannot be detected with a GSM Tester

6.3 Repair Documentation:

6.3.1 Description of procedure:

6.3.1.1 Diagnosis:

Use the diode test function of a multimeter to check the status of the diode. The typical voltage drop on the diode is 1.7 V when testing the diode function with the multimeter.

6.3.1.2 Repair by component change:

Use soldering iron to remove defective diode.
Avoid excessive heat!
Watch surrounding components!!

Resolder new connector afterwards.

6.3.1.3 Repair by Software booting:

Not possible!

6.3.1.4 Test:

Retest handset after repair.

6.3.2 List of needed material:

6.3.2.1 Components:

Keypad LEDS C60/C61
Part-Number: L36840-L2056-D670

V 1.0	Page 12 of 13	ICM MP CCQ GRM
A60/C60/C61	Company Confidential Copyright 2003© Siemens AG	09/03

6.3.2.2 Jigs and Tools:

Hot Air Blower
Soldering Iron

6.3.2.3 Special tools:

None

6.3.2.4 Working materials

Desolder Wick / Braid
Soldering Iron

6.3.3 Drawings

Figure 1: C60/C61 Keypad LEDs side

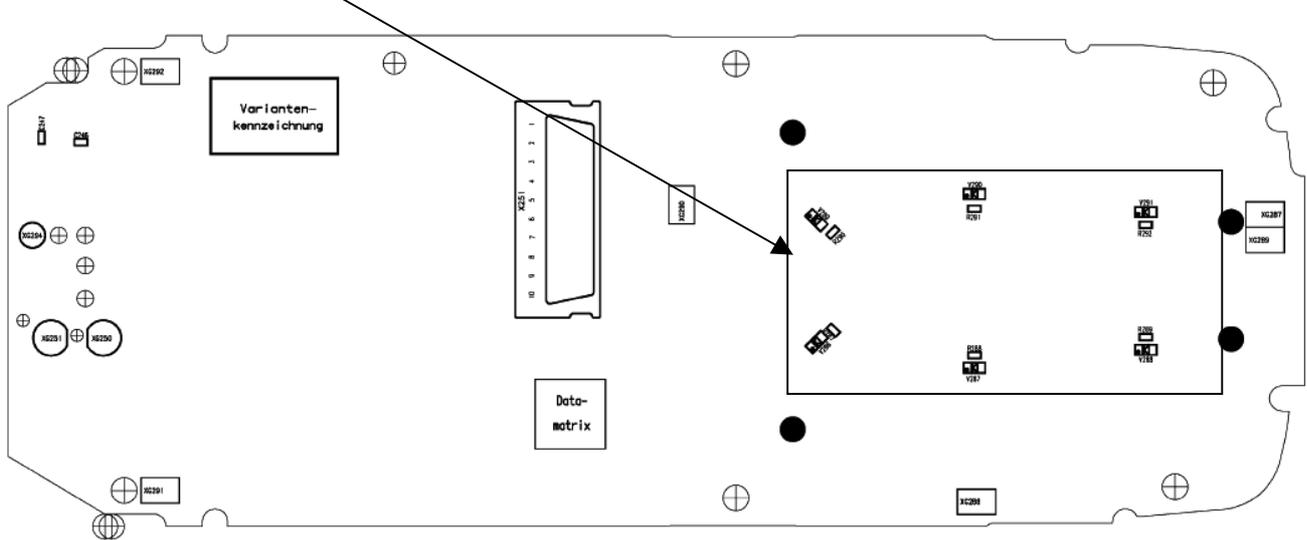


Figure 2: C60/C61 Keypad LEDs placement (top view)

