



Duplication of this document and the use or communication of the contents thereof are forbidden without express authority. Offenders are punishable and liable to the payment of damages. All rights are reserved in the event of the grant of a patent or the registration of a utility model.

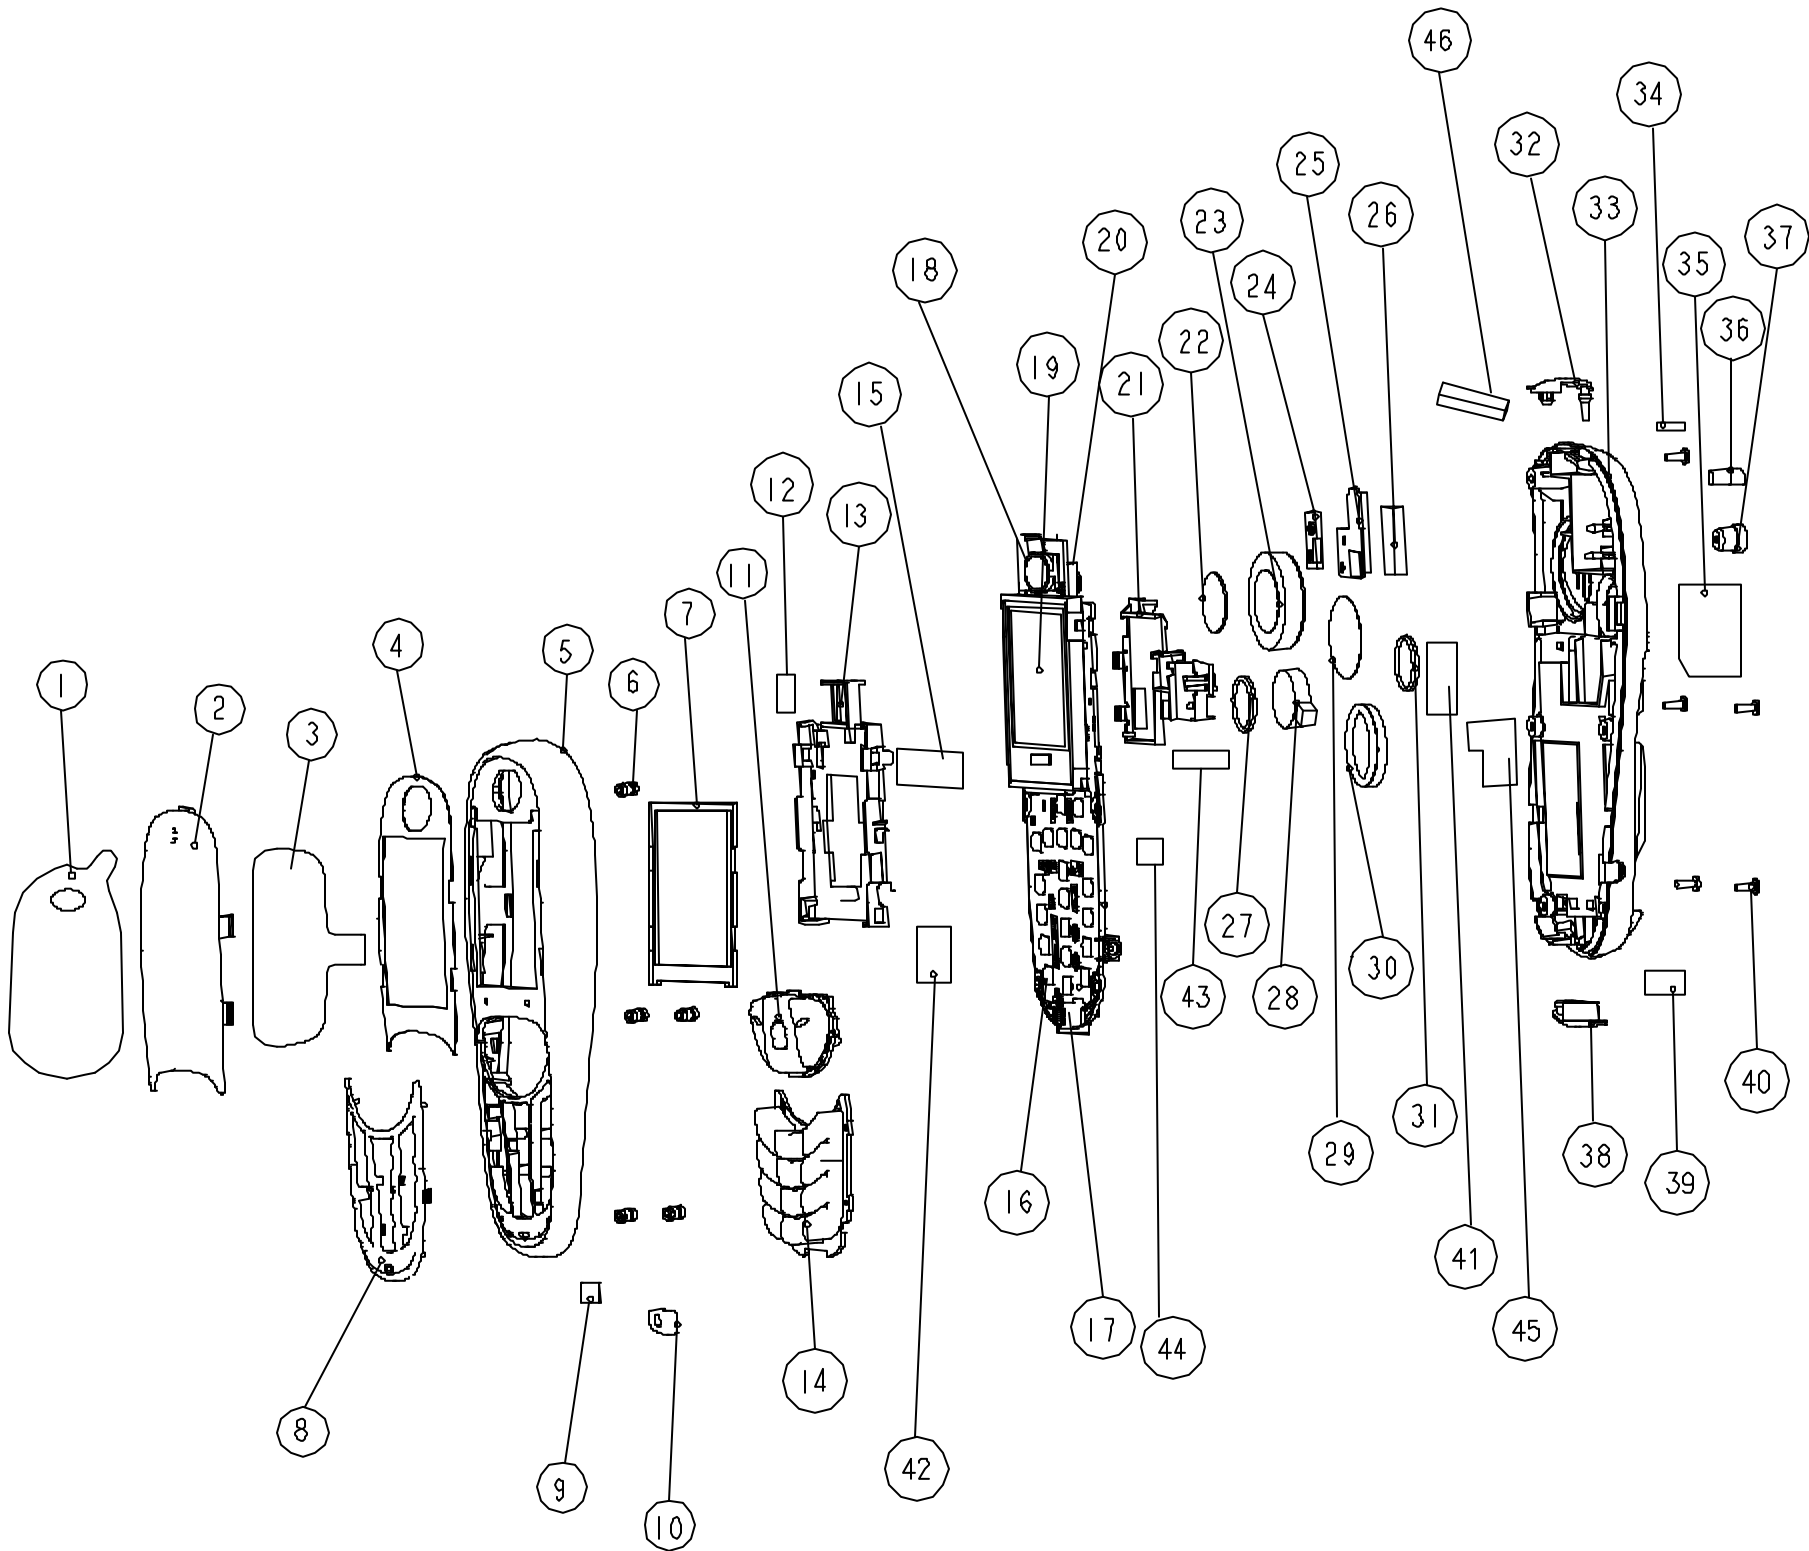


COVER ASSY,REAR	ACGM0028601	24,25,26,29,30,31,32,33,34,38,39,41,45,46
PCB ASSY, MAIN	SAFY0067516	16,17,18,19,20,21,22,23,27,28,44
COVER ASSY,FRONT	ACGK0030801	4,5,6,7,8,9,10
DESCRIPTION	DRAWING NO.	REMARK


46	PAD, SPEAKER CONNECTOR	1	MPBZ0049101	
45	PAD, MSM	1	MPBL0002001	
44	PAD, PMIC	1	MPBZ0049001	
43	GASKET, SHIELD	1	MGAZ0007001	
42	PAD, RF (BRACKET, LCD)	1	MPBZ0046301	
41	PAD, ABSORBER (REAR)	1	MPBZ0043801	
40	SCREW MACHINE	1	GMEY0004801	
39	INSULATOR	1	MIDZ0037001	
38	CAP,RECEPTACLE	1	MCCF0010901	
37	CAP,MOBILE SWITCH	1	MCCF0013101	
36	CAP,SCREW	1	MCCH0021001	
35	LABEL,APPROVAL	1	MLAA0002505	
34	LABEL,QUALCOMM	1	MLAN0000603	
33	COVER,REAR	1	MCJN0019201	
32	CAP,EARPHONE JACK	1	MCCC0013001	
31	PAD,MOTOR(REAR)	1	MPBJ0011701	
30	CAP, SPEAKER	1	MCCZ0007101	
29	FILTER, SPEAKER	1	MFBC0007301	
28	MOTOR	1	SJMY0002601	
27	PAD,MOTOR(SHIELD)	1	MPBJ0011801	
26	PAD,ANTENNA	1	MPBZ0036901	
25	ANTENNA MOBILE FIXED	1	SNMF0004501	
24	BRACKET, ANTENNA	1	MBFB0000901	
23	SPEAKER	1	SUSY0010501	
22	PAD,SPEAKER(SHIELD)	1	MPBN0008101	
21	FRAME,SHIELD	1	MFEA0004101	
20	CONTACT, ANTENNA	1	MCIA0007601	
19	LCD	1	SVI Y0018801	
18	RECEIVER	1	SURY0006901	
17	PCB, ASSY MAIN	1	SAFY0067516	
16	DOME ASSY,METAL	1	ADCA0016601	
15	PAD, LCD (DRIVER IC)	1	MPBZ0043701	
14	KEYPAD,DIAL	1	MKAA0009101	
13	BRACKET,LCD	1	MBFF0002401	
12	TAPE, RECEIVER	1	MTAZ0024801	
11	KEYPAD,FUNCTION	1	MKAZ0003501	
10	CAP, MIC	1	MCCZ0006901	
9	FILTER,MIKE	1	MFBD0003501	
8	DECO, FRONT	1	MDAG0005601	
7	PAD,LCD	1	MPBG0017701	
6	INSERT	5	MICZ0009701	
5	COVER,FRONT	1	MCJK0022401	
4	TAPE,WINDOW	1	MTAD0019401	
3	TAPE, PROTECTION	1	MTAB0032801	
2	WINDOW,LCD	1	MWAC0034301	
1	TAPE, PROTECTION	1	MTAB0032901	
NO.	DESCRIPTION	Q'TY	DRAWING NO.	REMARK

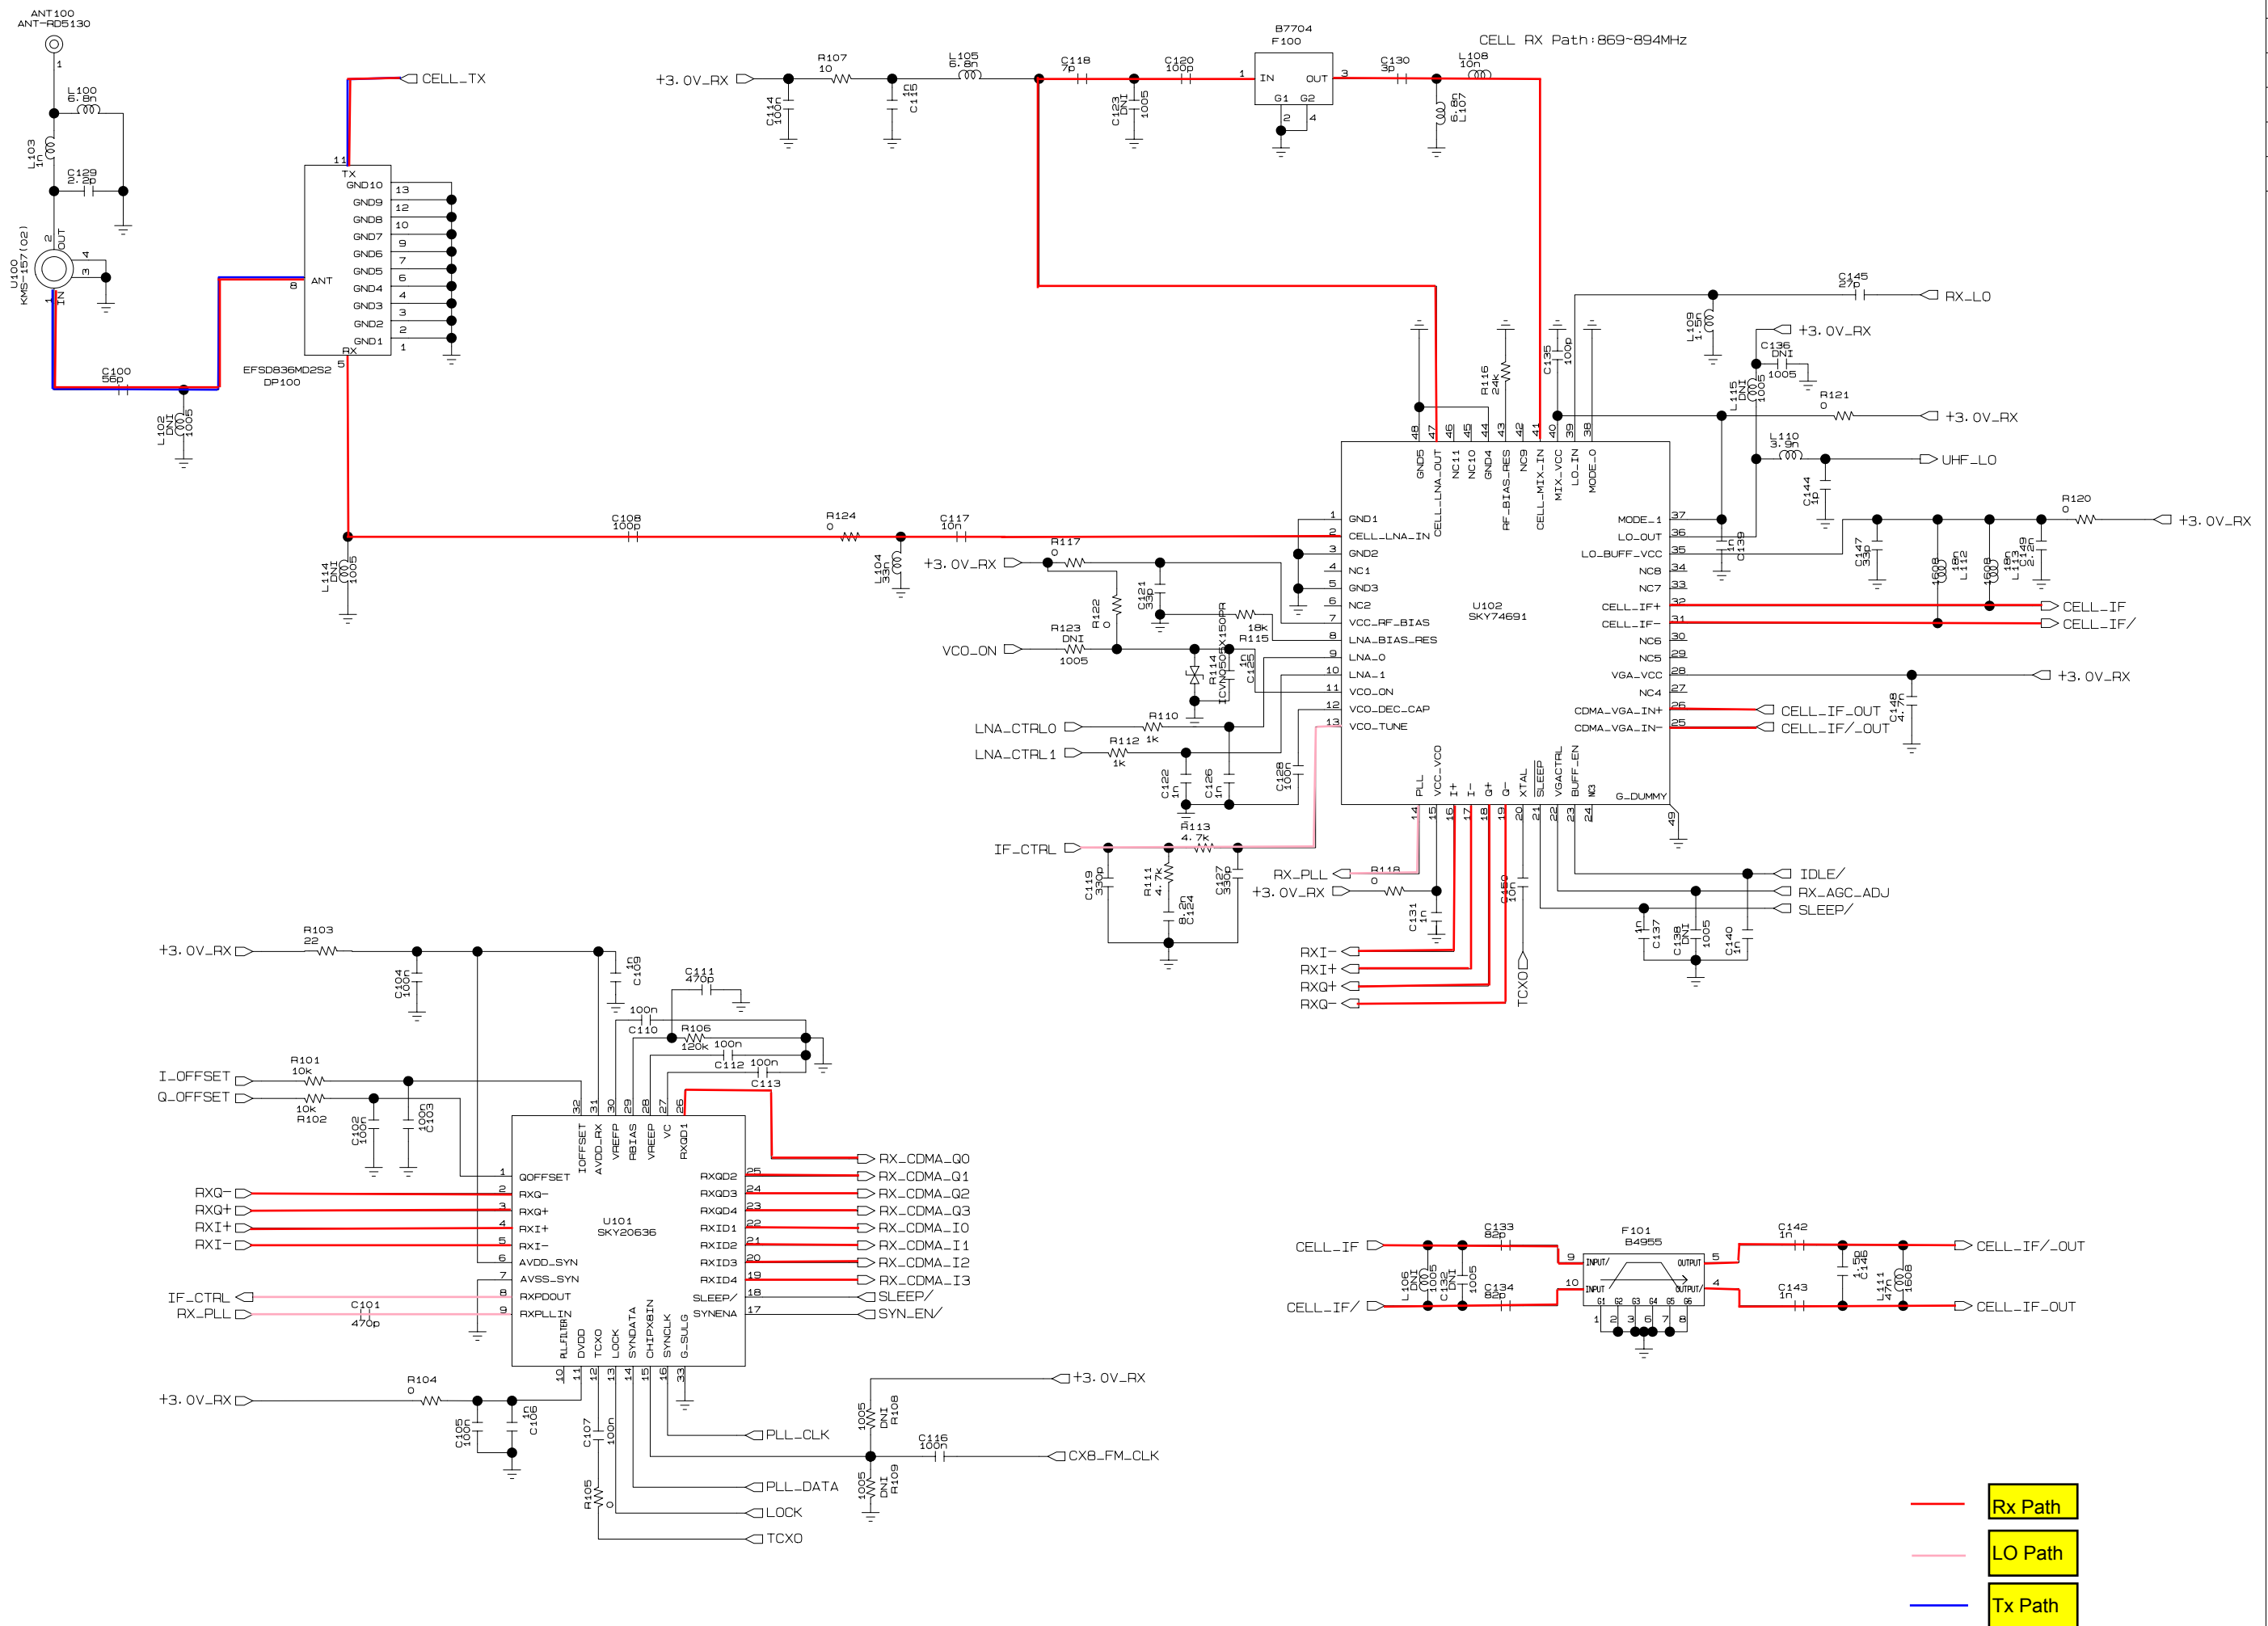


MEMORY (64M+ 16M)

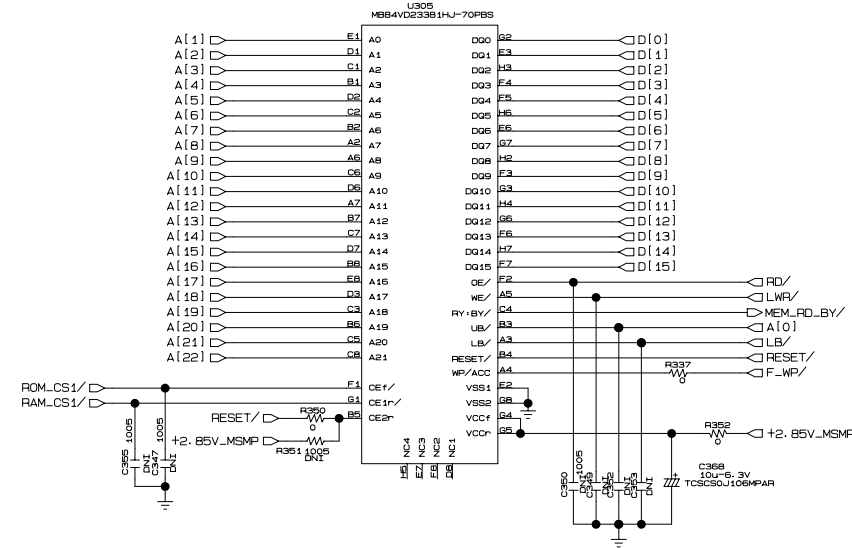


Motor Part

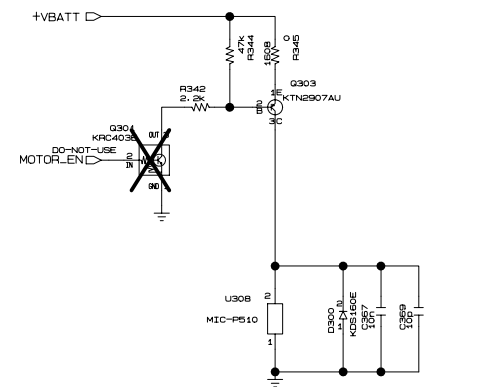


Ear Jack

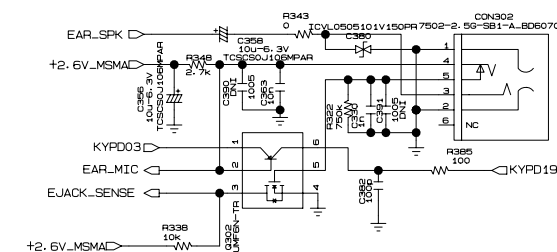


Audio AMP

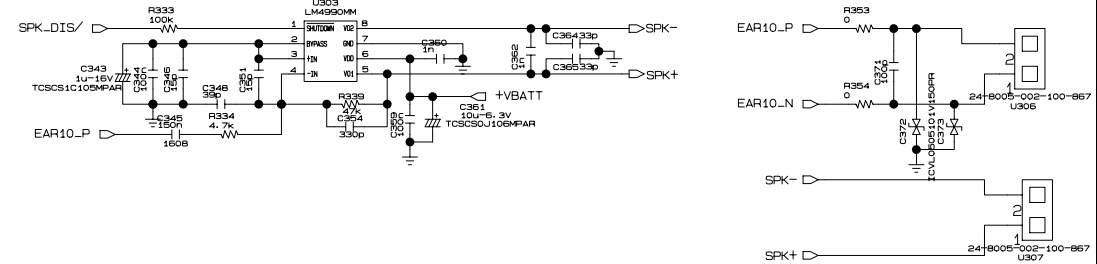


Battery Level



Therm Check

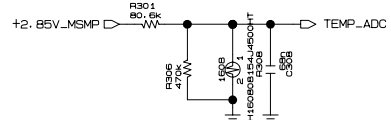

MIC Filter Network

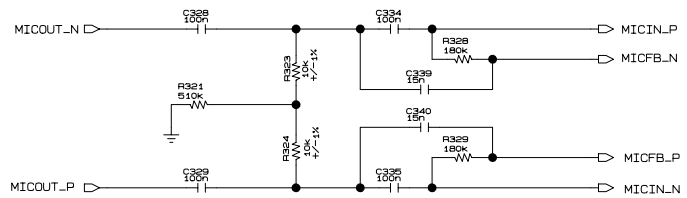


PCB VERSION




RX Path


TX Path


UIM CARD

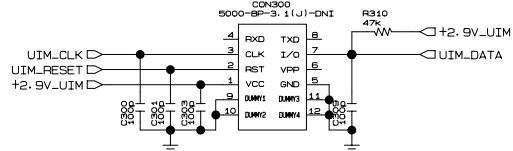

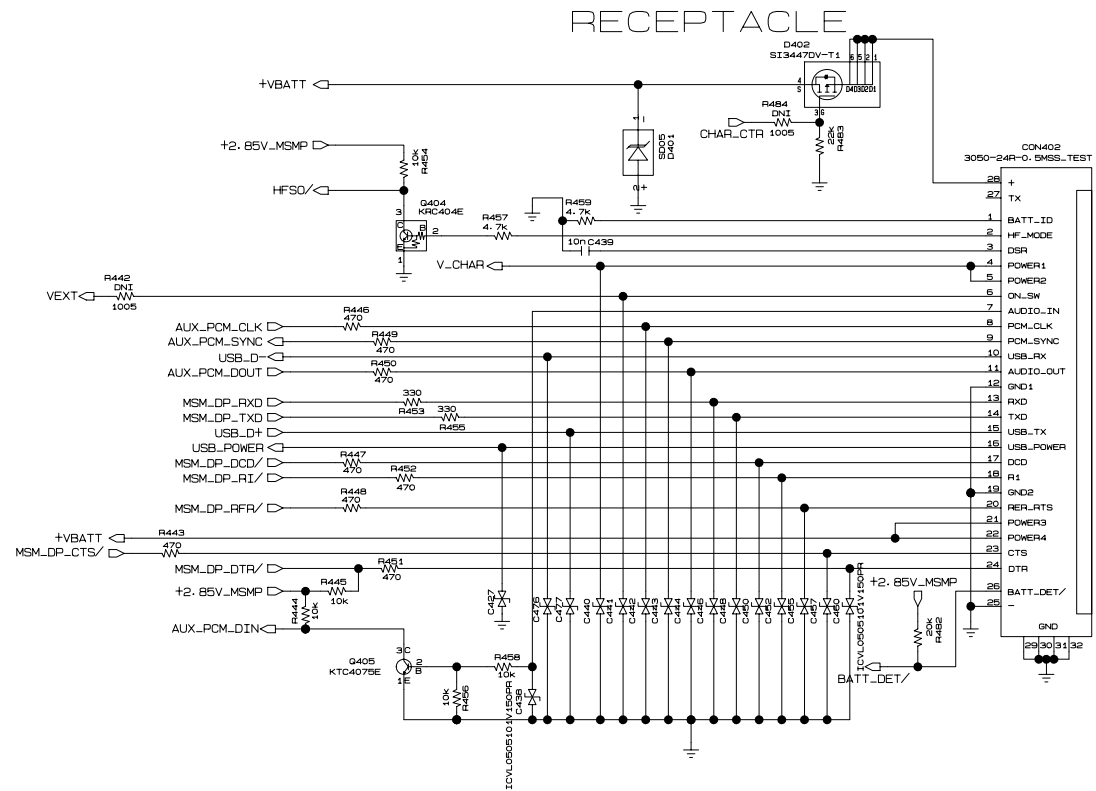

LCD Connector
(Color)

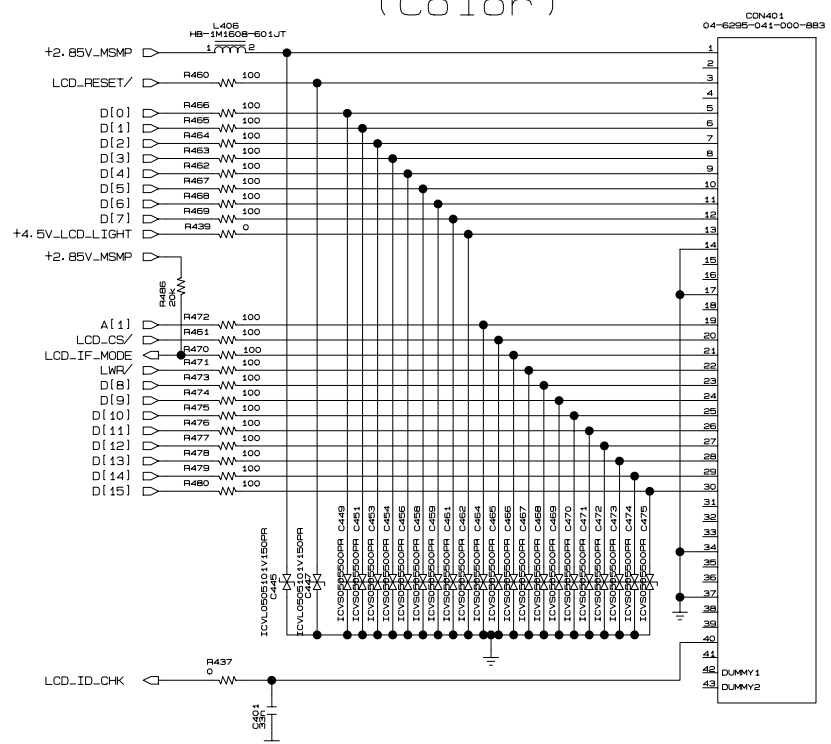

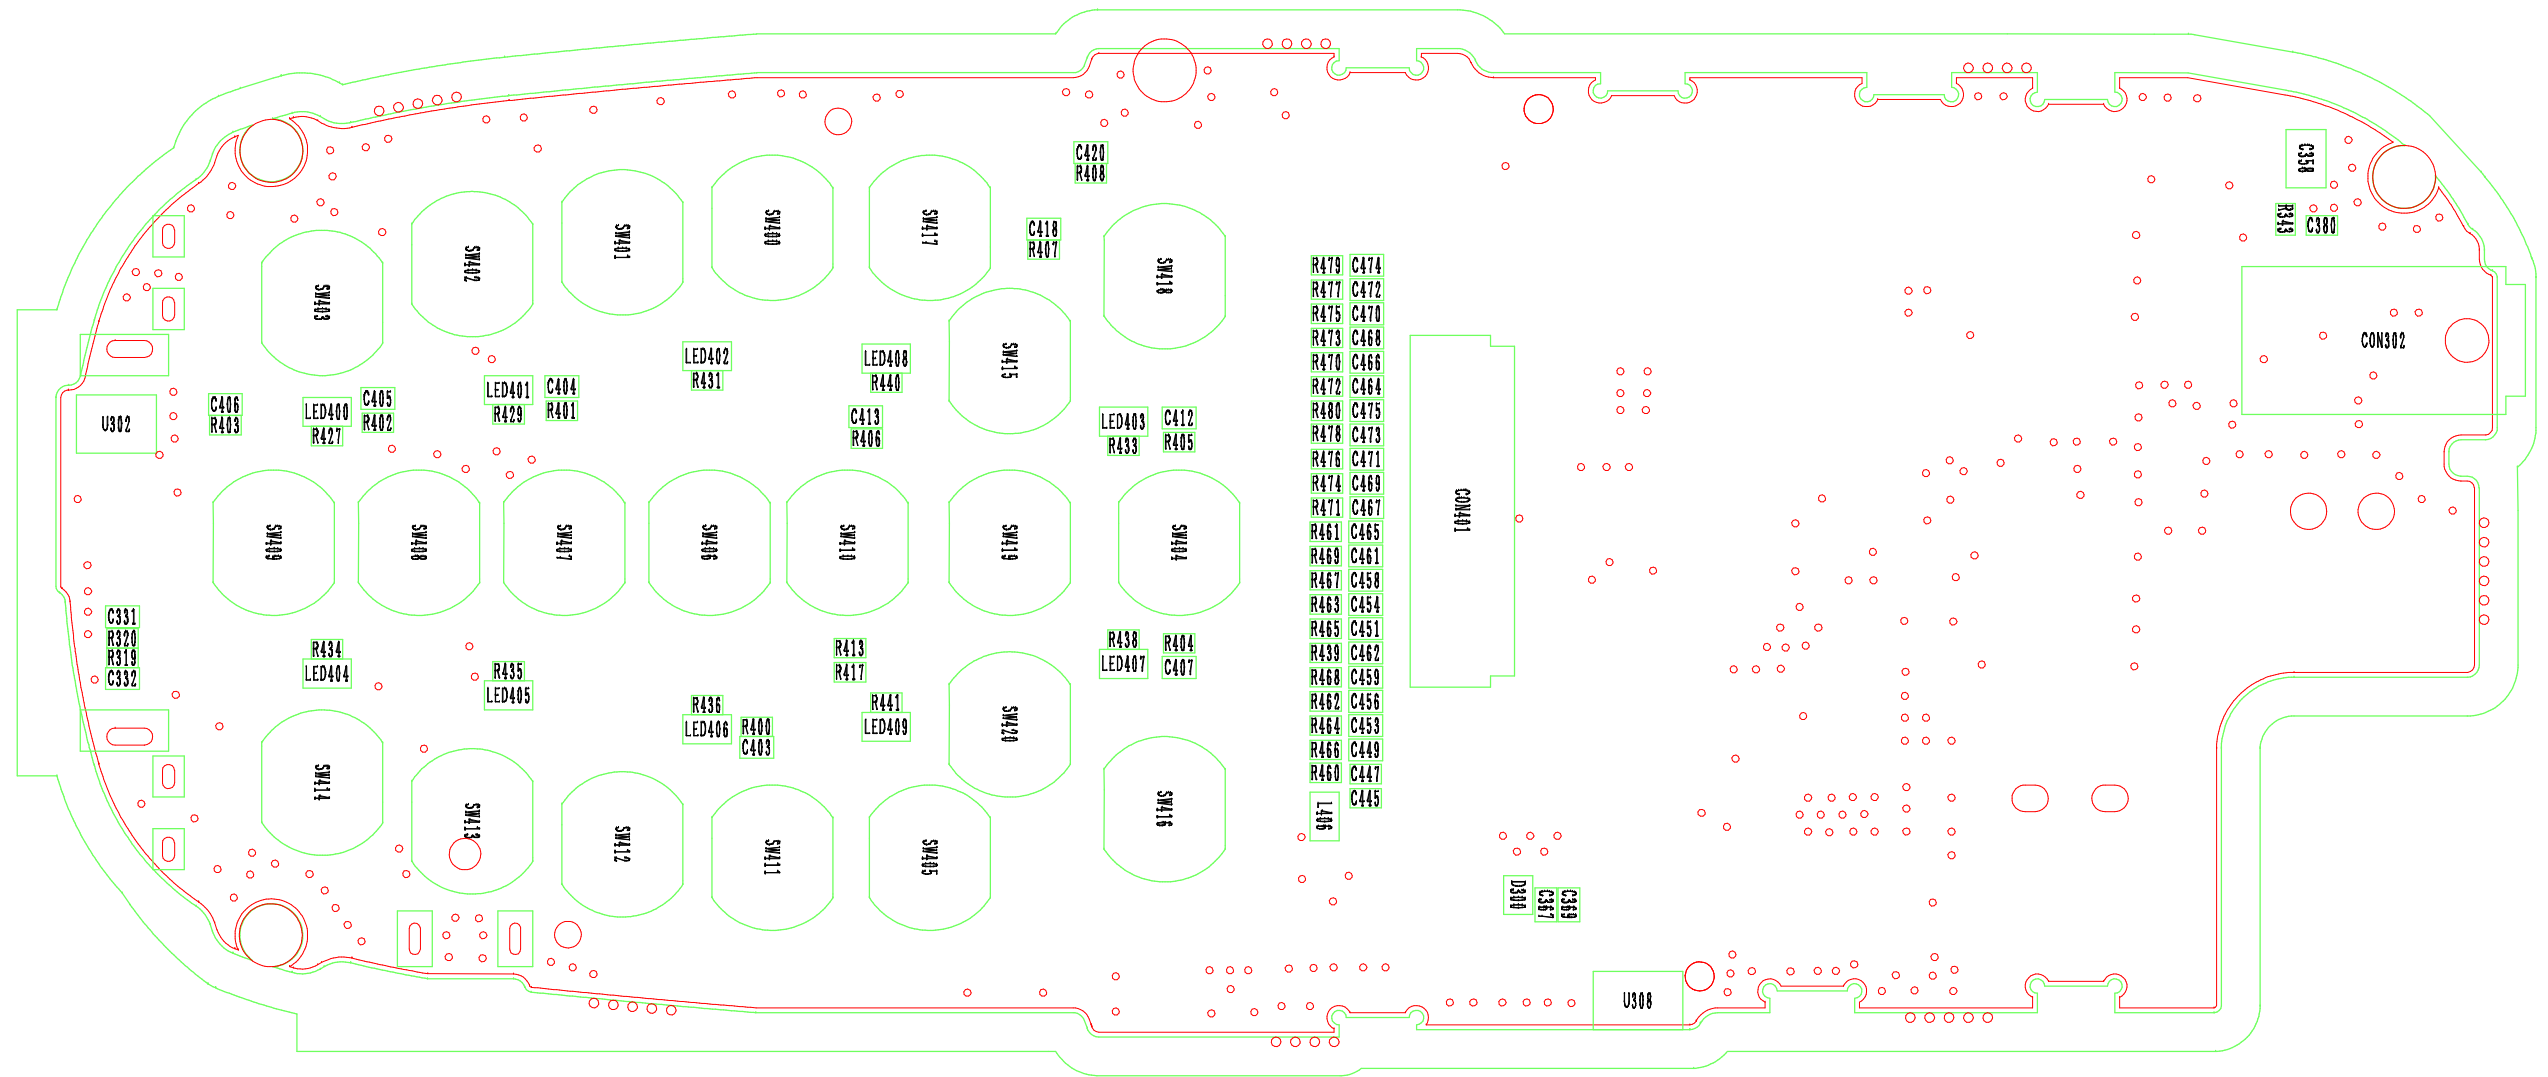

DC Jack
P/N : 7800-2.5T-DB1
Charging unable

Fresh Memory
P/N : MB84VD23381HJ-70PBS
No Booting

Mobile Station modem
P/N : MSM5105FBGA
**No Power ON
Sleep time Decrease**

VCTCXO
P/N : V19.20W2C3
**No Wake up
No Local Frequency**

Transmitter
P/N : SKY74702
**No Tx
Transmitter**

TX RF SAW
P/N : 856243
Low Tx power

Power Amp.
P/N : CX77105
**Low Tx power
No Service
No make call**

VCO
P/N : VC-2R8A80-2130A
**No Service
No Local Frequency**

Duplexer
P/N : EFSD836MD2S2
**Low sensitivity
No service
No make call**

Receptacle
P/N : 3050-24R-0.5MSS
No DM Connection

PMIC
P/N : MAX1505XETM
**No Charge
No Power ON**

Base band Analog processor
P/N : SKY20636
**Low sensitivity
No service
No make call**

RX IF SAW
P/N : B4955
**Low sensitivity
No service**

Receiver
P/N : SKY74691
**Low sensitivity
No service**

RX RF SAW
P/N : B7704
**Low sensitivity
No service**

